

Piping often accents couture fashions. The groove on the foot securely holds cording (must use size 30 cord diameter) close to needle for making or inserting piping. May use with tape guide attachment to wrap bias strip around cord before seam is sewn.


MACHINE SETUP

- 900 and 700 series – Chainstitch or 5 Thread
- 600 series – Safety 4 Thread
- Piping foot
- Polyester overlock/serger thread




SEWING

1. Cut a strip of bias tape at least 3.5 cm (1 3/8") wide. Wrap bias tape around cord with right side facing out.
2. Place bias tape and cord under presser foot with cord to left side of needle. Lower presser foot. Cord is correctly positioned if it is to the left side of needle(s) and in foot groove. Hand turn flywheel to lower needle(s) into fabric. Sew a small distance to make sure bias is feeding smoothly.
3. Place first fabric piece, right side up, under bias tape and second fabric piece, right side down, on top of bias tape. Sew slowly and check that cord, bias and fabrics are being guided correctly. Remember to check that bias tape is wrapped tightly around the cord during sewing.

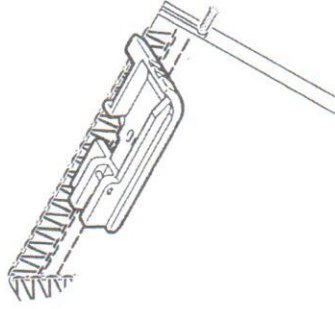


CREATE AND INSERT PIPING

The tape guide attachment folds and inserts bias strip into seam.

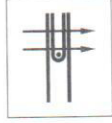

MACHINE SETUP

- Same as above

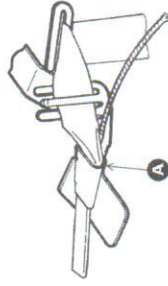

SEWING

1. Secure attachment stand and holder onto machine.
2. Insert cord into bias guide **A**. Cut a strip of bias tape 3.5 cm (1 3/8") wide. Cut one end at a 45° angle. Insert cut angle (fabric right side will face left) into bias guide **A** around cord. Secure tape guide to machine.
3. Place bias tape and cord under presser foot with cord to left side of needle. Lower presser foot. Cord is correctly positioned if it is to the left side of needle(s) and in foot groove. Hand turn flywheel to lower needle(s) into fabric. Sew a small distance to make sure bias is feeding smoothly.
4. Place first fabric piece, right side up, under bias tape and second fabric piece, right side down, on top of bias tape. Sew slowly and check that cord, bias and fabrics are being guided correctly. Remember, there will be extra cord and bias before fabric is inserted.

